

NUMERICAL APPROACH TO APPRAISAL AND CONTROL OF IBETO BATTERY PRODUCTION PROCESS

By

C.C. IHUEZE

Department of Industrial/Production Engineering
Nnamdi Azikiwe University Awka.

ABSTRACT

This paper presents a numerical approach to assessment of process capability and product quality standards for IBETO battery production process. Forty batteries produced by battery production process of IBETO factory were used in order to access their service lives. Eight replicated samples were made and each of the samples has sample size of five. The statistical sampling method, the average range method and the single range method were used to establish the mean of distribution, the average standard deviation of samples and the average range of samples to establish the process control limits. Process control was established using classical relations and analogies to establish process capability and Process capability index. The population mean was evaluated to be 3.4 years and the average standard deviation of the process as 0.75 years while the process capability was estimated to be 4.5 years. Also the action limits were found to be 4.4 years and 2.4 years for the mean.

The upper and lower specification limits were evaluated as 5.53years and 1.27years while the process capability index was estimated as 1.2. The coefficient of variation was found to be 21%, indicating low variability. The IBETO process for battery production therefore produces within specification. Hence this paper has presented procedures for assessment and control of quality of manufactured products.

1. INTRODUCTION

To meet design and customers specifications for a product for quality assurance, Quality Engineers perform quality tests of a process before mass production. Vonderembse and white[1] reported that the control of a process begins with the understanding of the variability of the process. The quality of a product depends upon the application of materials, men, machines and manufacturing conditions was reported by Hansen and Ghare[2]. It is a common

misconception that automatic machines will produce identical components.

Unfortunately, real life considerations interfere with this theoretical ideal, the properties of work piece material vary along the length of the bar, the machine tool slide way must have clearances to allow them to move, and lubrication conditions will constantly be changing, and such random variable will mean that the actual size of the parts produced will vary, distributed closely around the target sizes, Black et al [3]. When the quantity involved is large the pattern of variation can be studied on a statistical basis. It then becomes possible to assess the quality achieved by the process without testing every piece produced. A statistical method which reveals the pattern of variation in a product provides a more certain basis for the assessment of the quality of a large volume of work than would be provided by a detailed inspection of some parts made without reference to the pattern of variability present.

Quality failures occur due to various causes was reported by Sharma [4]. Studies indicated that more than 50% of quality failures are due to human errors at various levels, such as understanding of customer's requirements, manufacturing, inspection, testing, packaging, and design.

The objectives of quality control are, to decide about the standard of quality of a product that is easily acceptable to the customer and at the same time economical to maintain, to take necessary steps so that the products which are below standard should not reach to the customers, to take different measures to improve the standard of quality of product, to evaluate, maintain and improve quality standards during various stages of manufacture so as to build the desired quality in the finished product.

The process capability is commonly used to establish the relationship between the tolerance specified for the component and the standard deviation for the process that will make it. The capability of the process can be established once the specifications and the standard deviation of product parameter are measured and the process control is assured. This paper presented procedures for assessment and control of quality of manufactured products of a process as well as procedures for the evaluation of product capability.

Classical numerical methods, the sampling method, the average range method and the single range methods found in Hansen and Ghare(2006), Black et al[3], Sharma[4], Koshal[5], Dieter[6], Wal

pole [7], Stroud [8] were used as mixed method to find the mean, range, and standard deviation of distribution of measurements from where the process capability and capability index were evaluated and used to specify the quality standard of IBETO battery production process.

3 METHODOLOGY AND ANALYSIS

Forty batteries produced by battery production process of IBETO factory were used in order to access their service lives. Eight replicated samples were made and each of the samples has sample size of five as in Table 1. Classical numerical methods, the sampling method, the average range method and the single range method found in Hansen and Ghare[2], Black et al [3], Sharma [4], Koshal[5], Dieter[6], Walpole[7], Stroud [8] were used as mixed method to find the mean, range, and standard deviation of distribution of measurements from where the process capability and capability index were evaluated as in Dieter[6] using the mean and average standard deviation of distribution evaluated through the three methods employed.

3.1 Analysis of Population Data

Black et al [3], Sharma[4], Koshal [5], Dieter[6], Walpole [7] and Stroud [8]

were used to establish statistical parameters of quality of the car battery lives as follows:

- **Grouping of Data for Analysis of Table 1**

- Class intervals, c is chosen not less than 5 as recommended by Walpole (1982)

$$c = 7$$

- Class width w , is estimated by dividing the range R , with the class interval

$$R = 4.7 - 1.6 = 3.1$$

$$W = R/C = 3.1/7 = 0.443$$

The approximate class width can not be less than 0.443, a class width of $w = 0.5$ is therefore chosen as recommended in Walpole [7]

- **Establishment of Class boundaries:**

From data of Table 1 the lowest measure is 1.6. The lowest class boundary is therefore set as $1.6 - 0.05 = 1.55$, the upper class boundary of 1.55 is obtained by adding class width, 0.5 to the lower class boundary 1.55 to obtain, $1.55 + 0.5 = 2.05$. The first class boundary is therefore 1.55 – 2.05. The remaining six class boundaries of the seven intervals is obtained by adding the class width, 0.5 to the lower and upper class limits to obtain second class boundary as

$$1.55 + 0.5 - 2.05 + 0.5 = 2.05 - 2.55 \text{ and}$$

$$\text{third class as } 2.05 + 0.5 - 2.55 + 0.5 =$$

2.55 – 3.05, so that the seven class boundaries are established as presented in Table 2

Establishment of Class Interval:

Since the class interval is within the class boundaries and the first class boundary is 1.55 – 2.05, adding 0.05 to the lower class boundary and removing 0.05 from the upper class boundary establishes the first class interval 1.6 – 2.0. The remaining class interval are obtained by adding class width, 0.5 to the lower and upper class limits as $1.6 + 0.5 = 2.1$ and $2.0 + 0.5 = 2.5$ for the second class interval. For the third class interval $2.1 + 0.5 = 2.6$ and $2.5 + 0.5 = 3.0$, subsequently we have the following class intervals as in (Table 2)

• Establishment of class mark and its frequency

x = lower class boundary plus (+) upper class boundary

Divided by Two (2), Walpole [7] expressed as

$$x = \frac{LCB + UCB}{2}$$

The results of the above computations are presented in Table 2.

3.1.1 Estimation of Population

Parameters.

Computation of Mean of population, x^{11} is given by Walpole [7], as

$$x^{11} = \frac{\sum fx}{\sum f} \quad (1)$$

so that with Table 2 values in (1), $x^{11} = 137.5/40 = 3.44$ years

• Computation of Variance and Standard deviation

For grouped data, the computing relation for variance is expressed as

$$s^2 = \frac{(N \sum f_i x_i^2 - (\sum x_i)^2)}{(N - 1)} \quad (2)$$

so that by substituting Table 3 values in (2) $s^2 = 0.50$, $\sigma = s = 0.71$ years

• Coefficient of Variation, $V = \sigma/x^{11} = 0.71/3.44 = 0.21$

3.1.2 Computation of Mean of 8 Consecutive Samples

The columns of Table 1 represent measurements of 8 consecutive samples of battery lives, 5 samples taken at a time. It involves taking measurements of five batteries used at eight towns in Nigeria.

The means and ranges are computed using Table 4. The mean of samples average, x^{11} and Mean range, R^1 are computed with Table 4 as:

• Mean of samples average (grand average of samples). This is estimated with the relation of Dieter [6], as

$$x^{11} = \frac{1}{m} \sum_{i=1}^m \bar{x}_i \quad (3)$$

Where, m = number of samples, $\bar{x}^1$ = sample average. By using the values of x_i^1 = 3.2, 3.4, 3.4, 3.7, 3.4, 3.4, 3.5, 3.3 from Table 4 and $m=8$ in (3), $\bar{x}^1$ = 3.41 years

- **Mean range,**

This is also estimated with the relation of Dieter [6], as

$$R^1 = \frac{1}{m} \sum R_i \quad (4)$$

By using the values of R_i = 2.5, 2.7, 0.6, 1.9, 1, 1.1, 2.8, $i=1, i=1,2,3-8$ in (4), R^1 = 1.7 years.

3.2 Process Control Model.

Many classical scholars including Basterfield[9], Mittag and Rinne[10] and Breyfogles[11] also presented models for estimating warning and action limits of a process.

3.2.1 Measurement and Evaluation with Population Data.

- **Control Limits for Average.**

Black et al [3] expressed Action Limits and Warning limits for sample average respectively as

$$x_1 = \bar{x}^1 \pm (3.09\sigma)/\sqrt{n} \quad (5)$$

and

$$x_1 = \bar{x}^1 \pm (1.96\sigma)/\sqrt{n} \quad (6)$$

where

σ = bulk standard deviation, n = sample size, $\bar{x}^1$ = bulk mean

By putting $\sigma = 0.71$, $\bar{x}^1 = 3.44$, $n = 5$ in (5) and (6)

The values for action limit and warning limits were obtained as:

Upper action limit, UAL = 4.4 years,

Lower action limit, LAL = 2.5 years

Upper Warning Limit, UWL = 4.1 years,

Lower Warning Limit, LWL = 2.8 years

Alternatively the control limits for mean could be established using the relations of Sharma[4], and Table 6 in (7) as

$$x_1 = \bar{x}^1 \pm A_2 R^1 \quad (7)$$

$$UAL = \bar{x}^1 + A_2 R^1, \quad LAL = \bar{x}^1 - A_2 R^1$$

$$UAL = 3.4 + 0.58 * 1.7 = 4.4 \text{ years},$$

$$LAL = 3.4 - 0.58 * 1.7 = 2.4$$

- **Control Limits for Range**

Following Sharma [4], and Table 9, the upper and lower limits for the range are estimated as

$$UCL_R = D_4 * R^1 = 2.11 * 1.7 = 3.6 \text{ years},$$

$$LCL_R = D_3 * \bar{R} = 0 * 1.7 = 0$$

Koshal [5] approach could be used with Table 10 as:

- Action limits for mean = $\bar{x}^1 \pm A^1$
0.001 R^1 , UAL = $3.4 + 0.594 * 1.7 = 4.4$, LAL = 2.4

- Warning limits for mean = $\bar{x}^1 \pm A^1$
0.025 R , UWL = $3.4 + 0.377 * 1.7 = 4.4$, LWL = 2.4

- Action limit for Range = $R^1 * D_{0.999} = 1.7 * 2.34 = 4.4$ years,

- Warning limit for Range = $R^1 *$

$$D_{0.975} = 1.7 * 1.81 = 3.1 \text{ years}$$

The values of various factors, A^1 , D_4 , $D_{0.999}$, A_2 , D_3 , $D_{0.975}$ used in estimating the control charts action and warning limits for mean and range are found in Koshal [5], Table 9 and Table 10.

3.2.2 Measurement and Evaluation with Samples Data.

- Evaluation with Mean of Samples

This involves finding the average of all samples measurements, finding the grand average of samples and Computing the upper and lower control limits ,

By using Table 6 values in

$$(3) \bar{x}^{11} = 3.41 \text{ years}, R^1 = 1.7 \text{ years}$$

- Control Limit for Mean

Following Sharma [4], using Table 9 the control limits were established as follows. For a sample size of 5

$$A_2 = 0.58, D_3 = 0, D_4 = 2.11, d_2 = 2.33$$

- Action Limit

Upper control limit

$$\bar{x}^1 = \bar{x}^{11} + A_2 R^1 = 3.41 + 0.58 * 1.7 = 4.4 \text{ years} = \text{UCL}$$

Lower Control Limit

$$\bar{x}^1 = \bar{x}^{11} - A_2 R^1 = 3.41 - 0.58 * 1.7 = 2.4 \text{ years} = \text{LCL}$$

- Control Limit for Range

The Control Limits for range are established as:

$$UCL_R = D_4 * R^1 = 2.11 * 1.7 = 3.6 \text{ years},$$

$$LCL_R = D_3 * R^1 = 0 * 1.7 = 0 [2, 4, 5]$$

- Average Range Method

This is an alternative method for finding process capability from samples of product being produced. By using results of (4) in

$$\sigma^1 = R^1 / d_2 [2] \quad (8)$$

σ^1 = range relative standard deviation.

and also by employing Table A7 of [2] under sample size 5

$$d_2 = 2.326, \sigma^1 = 1.7 / 2.326 = 0.73 \text{ years}$$

- Single Range Method

This method depends on the average of samples standard deviations; it involves the initial computations of each sample standard deviation, s^1 with the classical relation for variance used as,

$$s^2 = \frac{\sum (x_i - \bar{x}^1)^2}{n-1} \quad (9)$$

Computations for standard deviation of each sample were made as follows using Table 2 and results presented in Table 7.

From Table 7 a, b, c, d, e, f, g, h. the standard deviation of samples were estimated with (9) and presented in Table 8 as follows:

$$s^2 = 2.184 = 0.545, s = 0.74, s^2 =$$

$$4.794 = 1.1975, s = 1.1$$

$$s^2 = 0.23/4 = 0.0575, s = 0.24, s^2 = 2.51/4 = 0.6275, s = 0.79$$

$$s^2 = 0.74/4 = 0.185, s = 0.43, s^2 = 0.84/4 = 0.21, s = 0.46$$

$$s^2 = 4.9/4 = 1.225, s = 1.11, s^2 = 0.74/4 = 0.185, s = 0.4$$

The average sample standard deviation is related in [2] as

$$s^1 = c_2/\sigma \quad (10)$$

where

σ = Bulk standard deviation of distribution or population standard deviation

c_2 = Factor, estimated in Table A7 of Hansen and Ghare [2] for sample size 5

$$c_2 = 0.8407$$

From (10) and Table A7, $s^1 = 5.3/8 = 0.66$ years

$$\sigma = s^1/c_2 = 0.66/0.8407 = 0.785 \text{ years}$$

3.4.1 Process Capability Index And Tolerance Specification

Breyfogles[11] gave relations for predicting the following process specification estimates as follows:

$$USL = x^{11} + 3\sigma \quad (11)$$

$$LSL = x^{11} - 3\sigma \quad (12)$$

$$C_p = (USL - LSL)/6\sigma \quad (13)$$

Where, USL= upper specification limit,

LSL=lower specification limit,

C_p = process capability index

The process capability index expressed by Dieter [6] is the ideal or theoretical

capability index, because the individual observations may not be centered on the mean, Dieter [6] gave two relations for predicting the actual process capability index as:

$$C_{pk1} = (USL - x^{11})/3\sigma \quad (14)$$

$$C_{pk2} = (x^{11} - LSL)/3\sigma \quad (15)$$

By using $x^{11} = 3.4$ years and the average standard deviation of distribution, C_p is obtained as follows:

$$\sigma = (0.71 + 0.73 + 0.785)/3 = 0.75 \text{ years,}$$

$$USL = 5.65 \text{ years, } LSL = 1.15 \text{ years,}$$

$$C_{p1} = 1, C_{p2} = 1 \text{ by (14) and (15), } \sigma = 0.71 \text{ and using (11) and (12)}$$

$$USL = 5.53, LSL = 1.27, 3\sigma = 2.13 \text{ and by employing (14, 15), } C_p = 1.2$$

3.2.4 Design Specification and Process Capability

The three major steps in the production of any item are, design, production and inspection so that the essence of process control is to ensure that the process produces within design specifications. Process capability is the best quality product of a process which is evaluated following the reports of Dieter[6], Basterfield [9], Mittag and Rinne [10] and Breyfogles [11] as

$$PC = 6\sigma \quad (16)$$

So that by using $\sigma = 0.75$ in (16)

$$PC = 4.5 \text{ years}$$

3.2.5 Process Validation.

The upper and lower production limits were evaluated as 4years and 2.4years respectively while upper and lower specification limits were evaluated as 5.53years and 1.27years respectively showing that the process is under control.

The excel graphics of Table 6 are presented in Figure 1 and Figure 2 as mean and range control charts for process control.

4. DISCUSSIONS ON RESULTS

Statistical methods were followed using Table1 of recorded car battery lives to generate through Tables 2 and 3 with which the coefficient of variation of distribution was estimated as 0.21. Tables 1,2 and 3 are fundamental tables for estimation of distribution parameters such as the mean, variance and standard deviation. While Table5 exhibited control limits estimated with different models, Table6 exhibited the variability in the mean and range of distribution samples. Table7 showed the computational tables that estimated the standard deviation of the distribution samples as presented in Table 8. The standard deviation results of eight samples presented in Table 8 conform with the standard deviation value of 0.71 estimated through classical relations as 0.71 falls within 0.65-0.75 of

Table8 estimated through the empirical methods of section3.2.2

The variability of the process estimated by measuring the standard deviation of distribution as 0.71years shows that variability of the process is low with the coefficient of variation estimated as 21%.

The process capability index and tolerance specification evaluation show that the process variability is low and the $C_p = 1.2$, showing that the process is producing within the upper and lower specification limit evaluated as 5.53years and 1.27years, above all, the mean and range estimated for the process under study shows that the process is producing within the mean and is under control.

CONCLUSIONS

- For a process to be under control, the process capability index must be up to 1.2
- The control limits estimated through classical and empirical relations must conform to the upper and lower specification limits for the product in view.
- The coefficient of variation of a controlled process should be low.

Above all, the process capability index of 1.2 and tolerance specification evaluation that showed process variability as being low showed that the process is producing within the upper and lower specification

limits evaluated as 5.53 years and 1.27 years. The IBETO Process for battery production is hence appropriate battery production process.

Table 1: IBETO Car Battery Lives

	Car Battery lives, years							
Sample	1	2	3	4	5	6	7	8
Measurements, years	2.2	4.1	3.5	4.5	3.2	3.7	3.0	2.6
	3.4	1.6	3.1	3.3	3.8	3.1	4.7	3.7
	2.5	4.3	3.4	3.6	2.9	3.3	3.9	3.7
	3.3	3.1	3.7	4.4	3.2	4.1	1.9	3.4
	4.7	3.8	3.2	2.6	3.9	3.0	4.2	3.5

Table 2: Group Class Data Distribution

Class Interval	Class Boundaries	Class Mark (x) =(LCB + UCB)/2	Frequency (f)	f(x)
1.6 – 2.0	1.55 – 2.05	1.8	2	3.6
2.1 – 2.5	2.05 – 2.55	2.3	2	4.6
2.6 – 3.0	2.55 – 3.05	2.8	5	14
3.1 – 3.5	3.05 – 3.55	3.3	15	49.5
3.6 – 4.0	3.55 – 4.05	3.8	8	30.4
4.1 – 4.5	4.05 – 4.55	4.3	6	25.8
4.6 – 5.0	4.55 – 5.05	4.8	2	9.6
SUM		23.1	40	137.5

Table 3: Computation of Variance data

	Class Mark x_i	Frequency f_i	x_i^2	$f_i x_i$	$f_i x_i^2$
	1.8	2	3.24	3.6	6.48
	2.3	2	5.29	4.6	10.58
	2.8	5	7.84	14	39.20
	3.3	15	10.89	49.5	163.35
	3.8	8	14.44	30.4	115.52
	4.3	8	18.49	25.8	110.94
	4.8	2	23.04	9.6	46.08
SUM	23.1	N = 40		137.5	492.15

Table 4: Computation of Means and Range of Consecutive Samples of Battery

	Car Battery lives, years							
Sample	1	2	3	4	5	6	7	8
Measurements, years	2.2	4.1	3.5	4.5	3.2	3.7	3.0	2.6
	3.4	1.6	3.1	3.3	3.8	3.1	4.7	3.7
	2.5	4.3	3.4	3.6	2.9	3.3	3.9	3.7
	3.3	3.1	3.7	4.4	3.2	4.1	1.9	3.4
	4.7	3.8	3.2	2.6	3.9	3.0	4.2	3.5
Sum, years	16.1	16.9	16.9	18.4	17	17.2	17.7	16.3
Mean, years	3.2	3.4	3.4	3.7	3.4	3.4	3.5	3.3
Range, years	2.5	2.7	0.6	1.9	1	1.1	2.8	1.1

Table 5: Control Limits Estimated with Different Models

	Mean			Range		
	UAL	LAL	UWL	LWL	UCL _R	LCL _R
Black (1996)	4.4 yrs	2.5 yrs	4.1	2.8	4.8	3.7
Sharma 2000	4yrs	2.4yrs			3.6 yrs	0
Koshal (1993)	4.4	2.4	4.4	2.4	4.4	3.1

Table 6: Means and Ranges of Samples, Extracted from Table 4

Sample Number	$\bar{x}^1$	R
1	3.2	2.5
2	3.4	2.7
3	3.4	0.6
4	3.7	1.9
5	3.4	1.0
6	3.4	1.1
7	3.5	2.8
8	3.3	1.1

Table 7: Computation of data for standard deviation of samples

a) Sample 1, $\bar{x}^1 = 3.2$, $n = 5$, $n-1 = 4$

x	$x - \bar{x}^1$	$(x - \bar{x}^1)^2$
2.2	-1	1
3.4	0.2	0.04
2.5	-0.7	0.49
3.3	0.1	0.01
4.7	0.8	0.64
Sum		2.18

b) Sample 2, $\bar{x}^1 = 3.4$, $n = 5$, $n-1 = 4$

x	$x - \bar{x}^1$	$(x - \bar{x}^1)^2$
4.1	0.7	0.49
1.6	-1.8	3.24
4.3	0.9	0.81
3.1	-0.3	0.09
3.8	0.4	0.16
Sum		4.79

c) Sample 3, $\bar{x}^1 = 3.4$, $n=5$, $n-1 = 4$

x	$x - \bar{x}^1$	$(x - \bar{x}^1)^2$
4.5	0.8	0.64
3.3	-0.4	0.16
3.6	-0.1	0.01
4.4	0.7	0.49
2.6	-1.1	1.21
Sum		2.51

d) Sample 4, $\bar{x}^1 = 3.7$, $n = 5$, $n-1 = 4$

x	$x - \bar{x}^1$	$(x - \bar{x}^1)^2$
3.5	0.1	0.01
3.1	-0.3	0.09
3.4	0	0
3.7	0.3	0.09
3.2	-0.2	0.04
Sum		0.23

e) Sample 5, $\bar{x}^1 = 3.4$, $n=5$, $n-1 = 4$

Sample 6, $\bar{x}^1 = 3.4$, $n=5$, $n-1 = 4$

x	$x - \bar{x}^1$	$(x - \bar{x}^1)^2$
3.2	-0.2	0.04
3.8	0.4	0.16
2.9	-0.5	0.25
3.2	-0.2	0.04
3.9	0.5	0.25
Sum		0.74

x	$x - \bar{x}^1$	$(x - \bar{x}^1)^2$
3.7	0.3	0.09
3.1	-0.3	0.09
3.3	-0.1	0.01
4.1	0.7	0.49
3.0	-0.4	0.16
Sum		0.84

g) Sample 7, $\bar{x}^1 = 3.5$, $n = 5$, $n-1 = 4$

h) Sample 8, $\bar{x}^1 = 3.3$, $n = 5$, $n-1 = 4$

x	$x - \bar{x}^1$	$(x - \bar{x}^1)^2$
3	-0.5	0.25
4.7	1.2	1.44
3.9	0.4	0.16
1.9	-1.6	2.56
4.2	0.7	0.49
Sum		4.9

x	$x - \bar{x}^1$	$(x - \bar{x}^1)^2$
2.6	-0.7	0.49
3.7	0.4	0.16
3.1	-0.2	0.04
3.4	0.1	0.01
3.5	0.2	0.04
Sum		0.74

Table 8: Variation of standard deviation of product samples.

Sample Number, m	Standard deviation, s
1	0.74
2	1.1
3	0.24
4	0.79
5	0.43
6	0.46
7	1.11
8	0.43
Sum	5.3

Table 9, Factors A_2 , D_3 , D_4 , d_2 , Sharma (2000)

No of units in sample	A_2	D_3	D_4	d_2
2	1.88	0	3.27	1.13
3	1.02	0	2.57	1.69
4	0.73	0	2.28	2.06
5	0.58	0	2.11	2.33
6	0.48	0	2.00	2.53
7	0.42	0.08	1.92	2.70
8	0.37	0.14	1.86	2.85
9	0.33	0.18	1.82	2.97
10	0.31	0.22	1.78	3.08
11	0.27	0.26	1.72	3.17
12	0.27	0.28	1.72	3.26
13	0.25	0.31	1.69	3.34
14	0.24	0.33	1.67	3.41
15	0.22	0.35	1.65	3.47

Table 10: Constants for limits on mean and Range control charts (Koshal, 1998)

	Normal mean Chart		Range Chart		Modified Limits	
Sample size, n	Warning limits $A'0.025$	Action limits $A'0.001$	Warning limits $D.975$	Action limits $D0.999$	Warning limits $A''0.025$	Action limits $A''0.01$
2	1.128	1.937	2.81	4.12	1.51	0.80
3	0.668	1.054	2.17	2.98	1.16	0.77
4	0.476	0.750	1.93	2.57	1.02	0.75
5	0.377	0.594	1.81	2.34	0.95	0.73
6	0.3116	0.498	1.72	2.21	0.90	0.71
7	0.274	0.432	1.66	2.11		
8	0.274	0.384	1.62	2.04		
9	0.244	0.347	1.58	1.99		
10	0.202	0.317	1.56	1.93		
11	0.186	0.294	1.53	1.91		
12	0.174	0.274	1.51	1.87		

REFERENCES

1. Vonderembse, M.A., and White, G.P., Operations Management: Concepts, Methods and Strategies, 2nd ed., West Publishing company New York, 1991
2. Hansen, B.L. and Ghare, P.M., Quality control and Application, Prentice-Hall of India Private Limited, New Delhi, 2006
3. Black, S.C., Chiles, V, Lissaman, A.J and Martin S.J., 1996. Principles of Engineering Manufacture, 3ed, ARNOLO Publishers London.
4. Sharma, S.C., Materials Management and Materials Handling, Khanna Publishers Del,hi, 3ed, 2000
5. Koshal, D., Manufacturing Engineers Reference book, Butterworth Heinemann Publisher 1998
6. Dieter, G.E. , Engineering Design: A Materials and Processing Approach, 3ed, McGraw-Hill International Edition Mechanical Engineering series, 2000.
7. Walpole, E., Introduction to Statistics, 3ed, Macmillan Publishing Co., Inc. New York, 1982.
8. Stroud, K. A., Engineering Mathematics, 4ed, McMillan Press limited London, 1995.
9. Basterfield, D.H., Quality Control, Prentice Hall, Inc. London, 1986
10. Mittag, H.J and Rinne, H., *Statistical Methods of Quality Control*, Chapman and Hall Publishers, London, 1993.
11. Breyfogles, F.W., Statistical Methods for testing, development and manufacture, John Wiley and sons Inc. 1992.